



# THOMAS

## *USE AND MAINTENANCE MANUAL*



04/2002



## Contents

<b>Contents .....</b>	<b>" 2</b>	7.1 - Blade tension assembly .....	" 10
<b>Ordering spare parts .....</b>	<b>" 2</b>	7.2 - Blade guide blocks .....	" 10
<b>Guarantee .....</b>	<b>" 2</b>	7.3 - Vice .....	" 10
<b>Machine certification and identification marking ....</b>	<b>" 3</b>	7.4 - Saw frame lowering control device .....	" 11
<b>CHAPTER 1 .....</b>		7.5 - Cutting angle adjustment .....	" 11
<b>Reference to accident-prevention regulations .....</b>	<b>" 4</b>	7.6 - Blade cleaning brush .....	" 11
1.1 - Advice for the operator .....	" 4	7.7 - Changing the blade .....	" 12
1.2 - Location of shields against accidental contact with the tool .....	" 4	7.8 - Replacing saw frame return spring .....	" 12
1.3 - Electrical equipment according to European Standard "CENELEC EN 60 204-1" .....	" 5		
1.4 - Emergencies according to European Standard "CENELEC EN 60 204-1" .....	" 5	<b>CHAPTER 8 .....</b>	
<b>CHAPTER 2 .....</b>		<b>Routine and special maintenance .....</b>	<b>" 12</b>
<b>Recommendations and advice for use .....</b>	<b>" 5</b>	8.1 - Daily maintenance .....	" 12
2.1 - Recommendations and advice for using the machine ..	" 5	8.2 - Weekly maintenance .....	" 12
<b>CHAPTER 3 .....</b>		8.3 - Monthly maintenance .....	" 12
<b>Technical characteristics .....</b>	<b>" 6</b>	8.4 - Six-monthly maintenance .....	" 12
3.1 - Table of cutting capacity and technical details .....	" 6	8.5 - Maintenance of machine operating members .....	" 12
<b>CHAPTER 4 .....</b>		8.6 - Oils for lubricating coolant .....	" 12
<b>Machine dimensions - Transport - Installation</b>		8.7 - Oil disposal .....	" 12
<b>Dismantling .....</b>	<b>" 6</b>	8.8 - Special maintenance .....	" 12
4.1 - Machine dimensions .....	" 6	<b>CHAPTER 9 .....</b>	
4.2 - Transport and handling of the machine .....	" 7	<b>Material classification and choice of tool .....</b>	<b>" 13</b>
4.3 - Minimum requirements for the premises housing the machine .....	" 7	9.1 - Definition of materials .....	" 13
4.4 - Anchoring the machine .....	" 7	9.2 - Selecting blade .....	" 13
4.5 - Instructions for electrical connection .....	" 7	9.3 - Teeth pitch .....	" 13
4.6 - Instructions for assembly of the loose parts and accessories .....	" 7	9.4 - Cutting and advance speed .....	" 14
4.7 - Disactivating the machine .....	" 7	9.5 - Blade running-in .....	" 14
4.8 - Dismantling .....	" 8	9.6 - Blade structure .....	" 14
<b>CHAPTER 5 .....</b>		9.7 - Blade type .....	" 14
<b>Machine functional parts .....</b>	<b>" 8</b>	Teeth shape and angle .....	" 14
5.1 - Operating head or saw frame .....	" 8	Set .....	" 15
5.2 - Vice .....	" 8	9.7.1 - Table of recommended cutting parameters .....	" 15
5.3 - Bed .....	" 8	<b>CHAPTER 10 .....</b>	
<b>CHAPTER 6 .....</b>		<b>Machine components .....</b>	<b>" 16</b>
<b>Description of the operating cycle .....</b>	<b>" 9</b>	10.1- List of spare parts .....	" 16
6.1 - Starting up and cutting cycle .....	" 9	<b>CHAPTER 11 .....</b>	
<b>CHAPTER 7 .....</b>		<b>Wiring diagrams .....</b>	<b>" 21</b>
<b>Regulating the machine .....</b>	<b>" 10</b>	<b>CHAPTER 12 .....</b>	
		<b>Troubleshooting .....</b>	<b>" 22</b>
		12.1- Blade and cutting diagnosis .....	" 22
		12.2- Electrical components diagnosis .....	" 26
		<b>CHAPTER 13 .....</b>	
		<b>Noise tests .....</b>	<b>" 26</b>
		<b>Plates and labels .....</b>	<b>" 27</b>

## Ordering spare part

- When ordering spare parts you must state:

MACHINE MODEL  
SERIAL NUMBER  
PART REFERENCE NUMBER

Without these references WE WILL NOT SUPPLY the spares. See point 10.1 - list of spare parts -

## Guarantee

- The Company guarantees that the machine to which this manual refers has been designed and built to comply with safety regulations and that it has been tested for functionality in the factory.
- The machine is guaranteed for 12 months: the guarantee does not cover the electric motors, electric components, pneumatic components or any damage due to dropping or to bad machine management, the failure to observe maintenance standards or bad handling by the operator.
- The buyer has only the right to replacement of the faulty parts, while transport and packing costs are at his expense.
- The serial number on the machine is a primary reference for the guarantee, for after-sales assistance and for identifying the machine for any necessity.



**THOMAS**

**SAR 250 GDS**

***Machine certification and identification marking***

**MACHINE LABEL**

<b>THOMAS S.p.A.</b>		<b>CE</b>
via Pasubio, 32 36033 ISOLA VIC. - ITALIA		
<b>MODEL</b>	SAR 250 GDS	
<b>TYPE</b>		
<b>SERIAL NUMBER</b>		
<b>YEAR OF MANUFACTURE</b>		

(Space reserved for the NAME and STAMP of the DEALER and/or IMPORTER)

--

# 1 REFERENCE TO ACCIDENT - PREVENTION REGULATIONS

This machine has been built to comply with the national and community accident-prevention regulations in force. Improper use and/or tampering with the safety devices will relieve the manufacturer of all responsibility.


## 1.1 - Advice for the operator



- Check that the voltage indicated on the plate, normally fixed to the machine motor, is the same as the line voltage.
- Check the efficiency of your electric supply and earthing system; connect the power cable of the machine to the socket and the earth lead (yellow-green in colour) to the earthing system.
- When the saw frame is in suspend mode (up) the toothed blade must not move.
- Only the blade section used for cutting must be kept unprotected. Remove guarding by operating on the adjustable head.
- It is forbidden to work on the machine without its shields (these are all white, blue or grey in colour).
- Always disconnect the machine from the power socket before blade change or carrying out any maintenance job, even in the case of abnormal machine operation.
- Always wear suitable eye protection.
- Never put your hands or arms into the cutting area while the machine is operating.
- Do not shift the machine while it is cutting.
- Do not wear loose clothing with sleeves that are too long, gloves that are too big, bracelets, chains or any other object that could get caught in the machine during operation; tie back long hair.
- Keep the area free of equipment, tools or any other object.
- Perform only one operation at a time and never have several objects in your hands at the same time. Keep your hands as clean as possible.
- All internal and/or internal operations, maintenance or repairs, must be performed in a well-lit area or where there is sufficient light from extra sources so as to avoid the risk of even slight accidents.

## 1.2 - Location of shields against accidental contact with the tool

- Blue, grey right and left hand metal shields, fastened with screws onto the guide blade stationary head ( Rif. A ).
- Blue or grey metal shield fastened with screws onto the blade guide adjustable head, ensures covering of blade section not used in cutting operation ( Rif. B ).
- Grey metal guard, fastened with knobs onto the saw frame, to protect from flywheels ( Rif. C ).

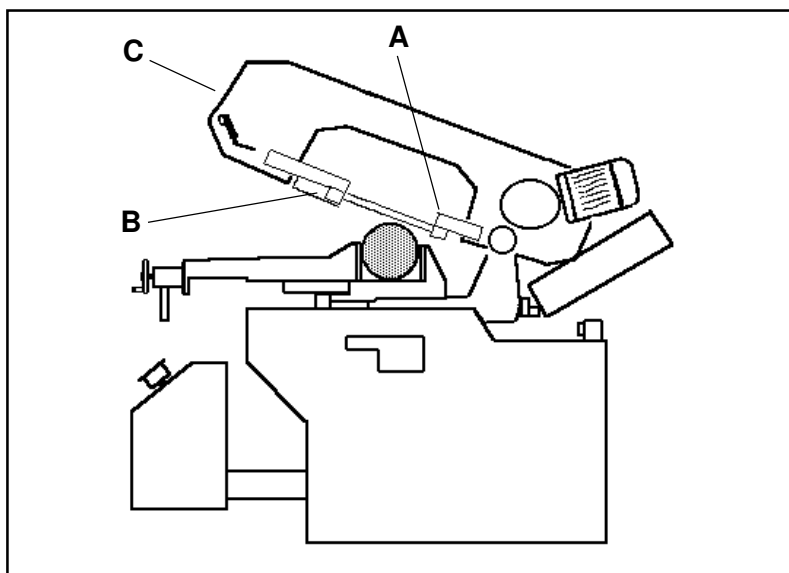

### 1.3 - Electrical equipment according to Euro-pean Standard "CENELEC EN 60 204-1" which assimilates, with some integrating modifications, the publication "IEC 204-1"

- The electrical equipment ensures protection against electric shock as a result of direct or indirect contact. The active parts of this equipment are housed in a box to which access is limited by screws that can only be removed with a special tool; the parts are fed with alternating current at low voltage (24 V). The equipment is protected against splashes of water and dust.
- Protection of the system against short circuits is ensured by means of rapid fuses and earthing; in the event of motor overload, protection is provided by a thermal probe.
- In the event of a power cut, the specific start-up button must be reset.
- The machine has been tested in conformity with EN 60204.

### 1.4 - Emergencies according to European Standard "CENELEC EN 60 204-1"


- In the event of incorrect operation or of danger conditions, the machine may be stopped immediately by pressing the red mushroom button.
- The casual or voluntary removal of the protection shield of the flywheels causes the stepping-in of a microswitch that automatically stops all machine functions.
- In case blade breaks, the tightening micro switch stops all machine functions.

NOTE: Resetting of machine operation after each emergency stop is achieved by reactivating the specific restart button.

## 2 RECOMMENDATIONS AND ADVICE FOR USE


### 2.1 - Recommendations and advice for using the machine

- The machine has been designed to cut metal building materials, with different shapes and profiles, used in workshops, turner's shops and general mechanical structural work.
- For the use of the machine, one operator having basic technical knowledge should stand in the position shown here below:

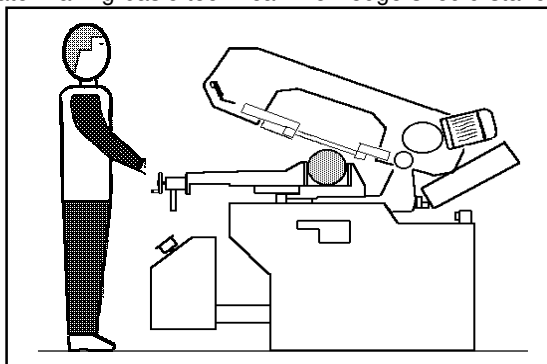

- Before starting each cutting operation, ensure that the part is firmly gripped in the vice and that the end is suitably supported.

These figures show examples of suitable clamping of different section bars, bearing in mind the cutting capacities of the machine in order to achieve a good efficiency and blade durability.

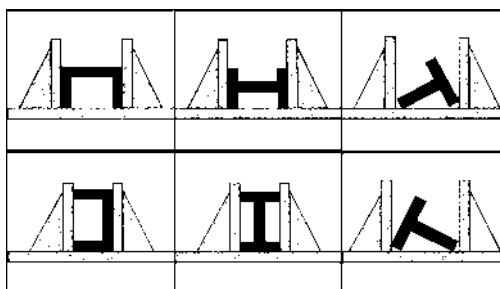




- Do not use blades of a different size from those stated in the machine specifications.
- If the blade gets stuck in the cut, release the running button immediately, switch off the machine, open the vice slowly, remove the part and check that the blade or its teeth are not broken. If they are broken, change the tool.
- Check saw frame return spring to ensure proper balancing.
- Before carrying out any repairs on the machine, consult the dealer or apply to THOMAS.



### 3 TECHNICAL CHARACTERISTICS



#### 3.1 - Table of cutting capacity and technical details

			
0°	255	250	300 x 200
45°	160	140	170 x 120
45° DX	190	180	190 x 170
60°	110	110	110 x 150

TECNICAL DATA		
BLADE MOTOR	Kw	1 - 1,4
COOLANT LIQUID MOTOR	Kw	0,07
HYDRAULIC PUMP MOTOR	Kw	
SERVICE PRESSURE	Bar	30
BLADE DIMENSIONS	mm	2750 x 27 x 0,9
FLYWHEEL Ø	mm	300
CUTTING SPEED	m/1'	33 - 66
VICE OPENING	mm	305
SAWFRAME INCLINATION	°	30
WORKING TABLE HEIGHT	mm	740
MACHINE WEIGHT	Kg	450


### 4 MACHINE DIMENSIONS TRANSPORT INSTALLATION DISMANTLING

#### 4.1 - Machine dimensions

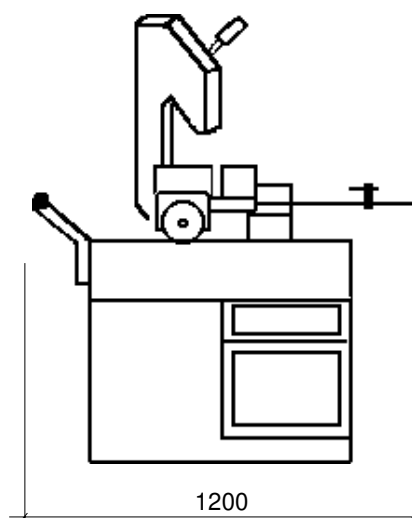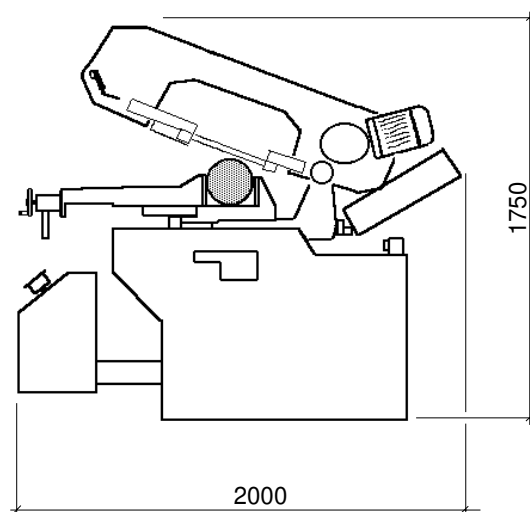

### 4.2 - Transport and handling of the machine


If the machine has to be shifted in its own packing, use a fork-lift truck or sling it with straps as illustrated.

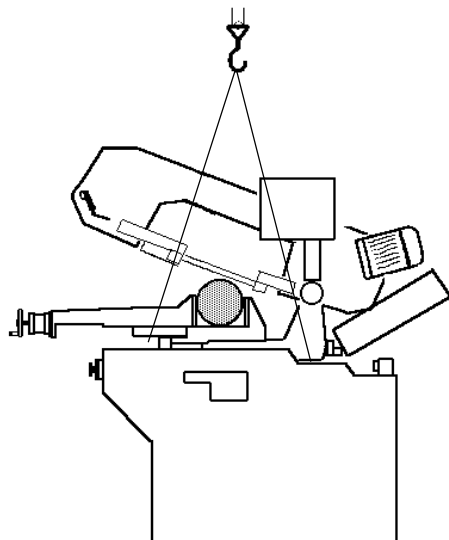

### 4.3 - Minimum requirements for the premises housing the machine

- Mains voltage and frequency complying with the machine motor characteristics.
- Environment temperature from -10 °C to +50 °C.
- Relative humidity not over 90%.

### 4.4 - Anchoring the machine

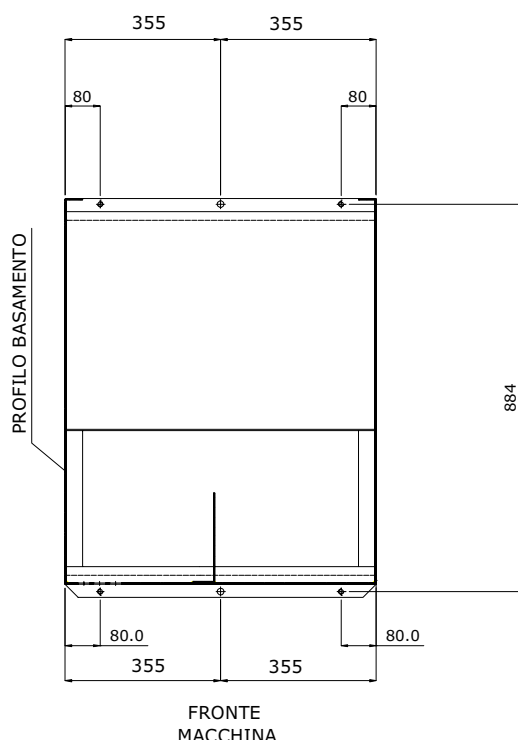


- Position the machine on a firm cement floor, maintaining, at the rear, a minimum distance of 1000 mm from the wall; anchor it to the ground as shown in the diagram, using screws and expansion plugs or tie rods sunk in cement, ensuring that it is sitting level.

### 4.5 - Instructions for electrical connection

 - The machine is not provided with an electric plug, so the customer must fit a suitable one for his own working conditions:

#### 1 - WIRING DIAGRAM FOR 4-WIRE SYSTEM FOR THREE-PHASE MACHINE - SOCKET FOR A 16A PLUG



### 4.6 - Instructions for assembly of the loose parts and accessories

Fit the components supplied:

- Mount bar-stop rod
- Mount and align the roll supporting arm as per the counter-vice table.
- Mount the metal protection against coolant splashing on the left side of the machine base.

### 4.7 - Disactivating the machine

- If the sawing machine is to be out of use for a long period, it is advisable to proceed as follows:

- 1) detach the plug from the electric supply panel
- 2) loosen blade
- 3) empty the coolant tank
- 4) carefully clean and grease the machine
- 5) if necessary, cover the machine.



### 4.8 - Dismantling

(because of deterioration and/or obsolescence)

#### General rules

If the machine is to be permanently demolished and/or scrapped, divide the material to be disposed of according to type and composition, as follows:

- 1) Cast iron or ferrous materials, composed of metal alone, are **secondary raw materials**, so they may be taken to an iron foundry for re-smelting after having removed the contents (classified in point 3);
- 2) electrical components, including the cable and electronic material (magnetic cards, etc.), fall within the category of material classified as being **assimilable to urban waste** according to the laws of the European community, so they may be set aside for collection by the public waste disposal service;
- 3) old mineral and synthetic and/or mixed oils, emulsified oils and greases are **special refuse**, so they must be collected, transported and subsequently disposed of by the old oil disposal service.

NOTE: since standards and legislation concerning refuse in general is in a state of continuous evolution and therefore subject to changes and variations, the user must keep informed of the regulations in force at the time of disposing of the machine tool, as these may differ from those described above, which are to be considered as a general guide line.

### 5.2 - Vice

- System for clamping the material during the cutting operation, operated with approach handwheel and locking lever or by a pneumatic device (optional).



## 5 MACHINE FUNCTIONAL PARTS

### 5.1 - Operating head or saw frame

- Machine part consisting of the members that transfer the motion (garmotor, flywheels), and tension/guide (blade-guides, blade tension slide).



### 5.3 - Bed

- Support structure for the OPERATING HEAD OR SAW FRAME (rotating arm for gradual cutting, with respective blocking system), the ELECTRIC BOX, the VICE, the BAR STOP, the material support ROLLER and the housing for the cutting coolant TANK and pump.





# 6 DESCRIPTION OF THE OPERATING CYCLE

Before operating, all the main organs of the machine must be set in optimum conditions (see the chapter on "Regulating the machine").

## 6.1 - Starting up and cutting cycle

### DESCRIPTION OF THE CUTTING PROCESS:

- Manual closure of the vice;
- Lowering of the sawframe ( blade );
- Manual lifting of the sawframe;
- Manual opening of the vice.

### PRELIMINARY OPERATIONS:

- Ensure that the machine is not in emergency stop condition; if it is, release the red mushroom buttons ( 1 ) both on the control unit and foot control switch.
- Rotate the blade tension handwheel ( 2 ) clockwise until the microswitch button ( 3 ) is pressed down.
- Pull the regulator knob ( 4 ) to stop the sawframe descent.
- Lift saw frame completely.
- Select the cutting speed on commutator ( 5 ):

**Position 1 = 33 m/min.**

**Position 2 = 66 m/min.**




**ATTENTION:** Make sure that the vice has been positioned to the far right or left of the countervise to avoid accidental impact with the sawblade. Also make sure that the relevant lever has been locked (*also see Chapter 7 paragraph 7.3*).

- Place the piece to be cut inside the vice by moving jaw to about 3 - 4 mm and lock with lever ( 8 ).
  - Press the knob of the regulator controlling the downfeed rate ( 4 ) and open it slightly to approach the blade up to 10mm from the workpiece. Stop the downfeed by turning the knob clockwise.
  - Press the start button ( 9 ), and check that the blade is turning in the direction indicated. Make sure that the cooling liquid flows regularly.
  - Adjust the device for the control of the saw frame lowering ( 4 ).
- Note : Initially, we recommend to set slow downfeed rate.

- At the end of the cut, pull the knob ( 4 ) and raise the sawframe manually. This way, the sawframe will stop at the top position and the downfeed rate remains unchanged.



**Keep your hands off the cutting area**

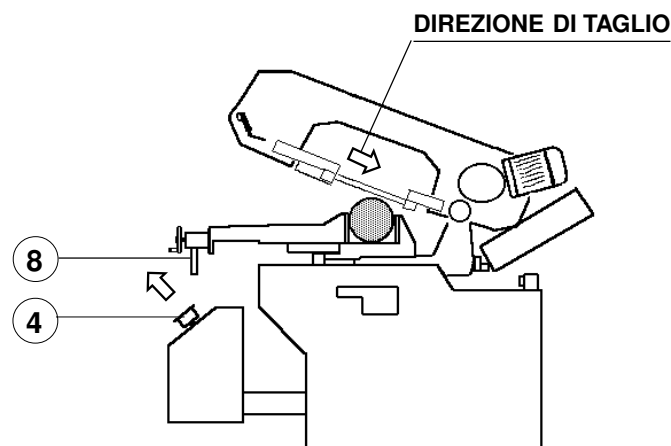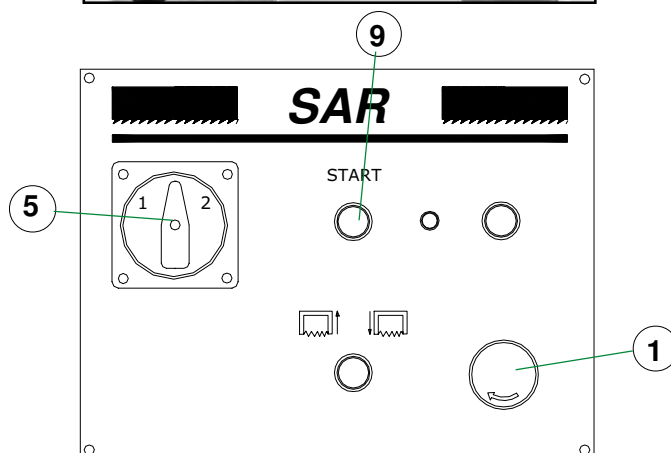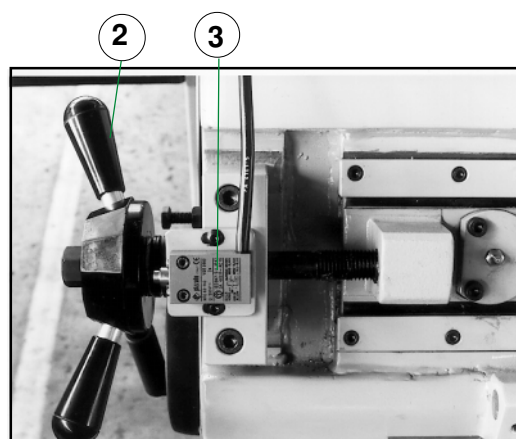

Note: In case the saw is not used for a period of time, release the blade tension to avoid useless stress.

The band saw is now ready to start work, bearing in mind that the CUTTING SPEED and the TYPE of BLADE - combined with a suitable descent of the head - are of decisive importance for cutting quality and for machine performance (for further details on this topic, see below in the chapter on "Material classification and blade selection").


- When starting to cut with a new blade, in order to safeguard its life and efficiency, the first two or three cuts must be made while exerting a slight pressure on the part, so that the time taken to cut is about double the normal time (see below in the chapter on "Material classification and blade selection" in the section on *Blade running-in*).
- Press the red emergency button ( 1 ) when there are conditions of danger or malfunctions in general, so as to stop machine operation immediately.

# 7 REGULATING THE MACHINE

## 7.1 - Blade tension assembly


The ideal tension of the blade is achieved rotating the handwheel until it stops against the microswitch button ( A ).

**WARNING:** the projection of the microswitch is factory set during inspection, after having tightened the blade on the lengthening values indicated by its manufacturer as per specific dimensions set with the help of a special gauge. If, when replacing the blade, the thickness and the width differ, it will be necessary to correct the projection of the microswitch. For this purpose we suggest to strictly select blades having the same features as the ones mounted originally.

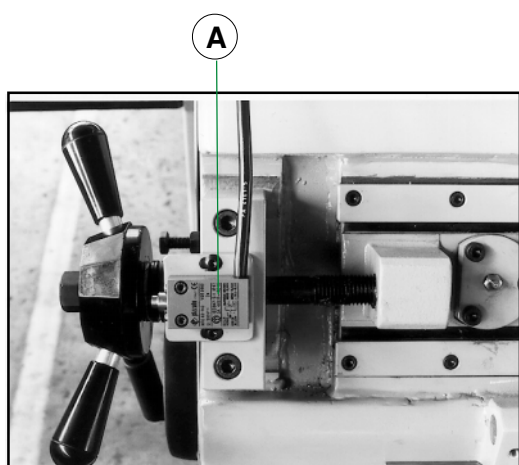

## 7.2 - Blade guide blocks

The blade is guided by means of adjustable pads set in place during inspection as per the thickness of the blade with minimum play as shown in the figure.

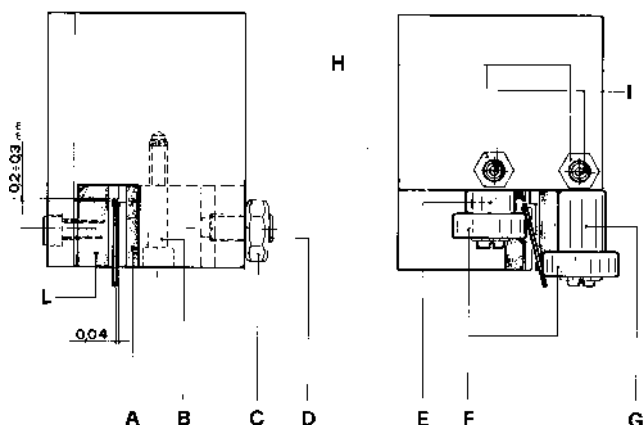


In case the blade needs to be replaced, make sure to always install 0.9 mm thick blades for which the blade guide pads have been adjusted. In the case of toothed blades with different thicknesses adjustment should be carried out as follows:

- Loosen nut ( C ), screw ( B ) and loosen dowel ( D ) widening the passage between the pads.
- Loosen the nuts ( H ) and the dowels ( I ) and rotate the pins ( E - G ) to widen the passage between the bearings ( F ).
- Mount the new blade, place the pad ( A ) on the blade and, loosening the dowel, allow a play of 0.04 mm for the sliding of the toothed blade; lock the relative nut and screw ( B ):
- Rotate the pins ( E - G ) until the bearings rest against the blade as indicated in the figure and then secure the dowels ( I ) and nut ( H ).
- Make sure that between the blade and the upper teeth of the pad ( L ) this is at least 0.2 - 0.3 mm of play; if necessary, loosen the screws that fasten the blocks and adjust accordingly.


## 7.3 - Vice

- The vice can be positioned either to the right or to the left of the blade. Tight Lever ( 2 ) after positioning the vice to the far right/left. The vice can slide very quickly by means of the handle ( 1 ); in case the vice moves too loose along the guide, tight the screws ( 3 ).
- Approach the vice jaw allowing 3-4 mm clearance between jaw and material.

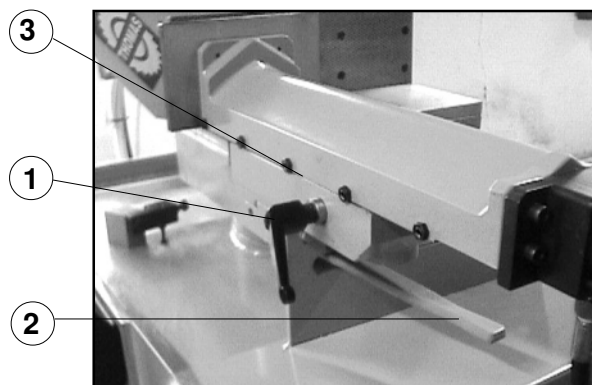


### 7.4 - Saw frame lowering control device

It is a device that determines a constant lowering and consequently a good efficiency of the blade throughout the work phase. By adjusting the knob (4 pag. 9), this device can be accommodated to the different situations and applications. The adjustment has two positions: if pressed and opened, it allows the lowering of the saw frame, if pulled it instantly stops the lowering but still maintains setting. Defectiveness in the control of the lowering may be caused by the drop in braking power of the device due to the long-term blow-by of the braking fluid. Push rod back into its seat and loosen plug (2). Use recommended oil to top up oil tank (3) with the help of a syringe-type pump. Bleed air, after having tightened plug (2) and loosen screw (4) lightly until a little oil drip out; when this has been completed, secure the screw. Use SHELL HYDRAULIC OIL 32 or similar.

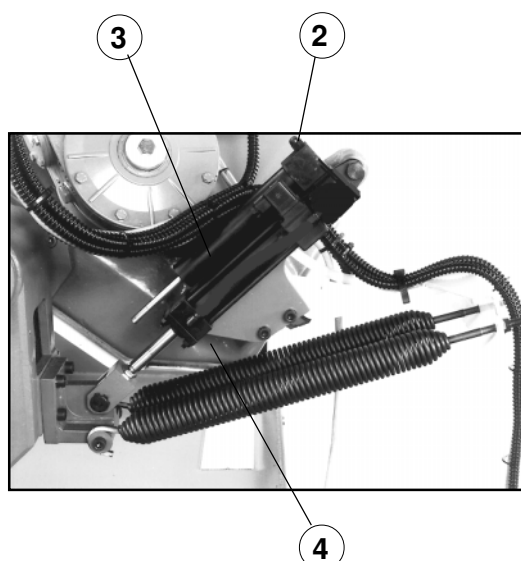


### 7.6 - Blade cleaning brush

It is an ideal accessory for the cleaning of the blade during the cutting cycle. Periodically check the condition of the brush and if necessary proceed to further adjustment to ensure cleaning of the blade.

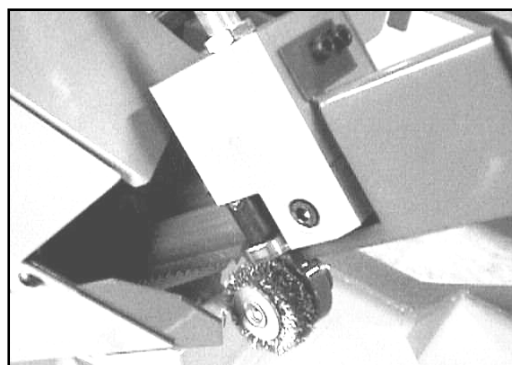

### 7.5 - Cutting angle adjustment

- Release lever (11), rotate the saw frame arm until it reaches the mechanical stop position at far angle and check that the zero index corresponds to 45/60°; if necessary operate on the rotation stop screws.
- Make sure that the wanted angle perfectly meets with the reference index before locking with the lever (11).

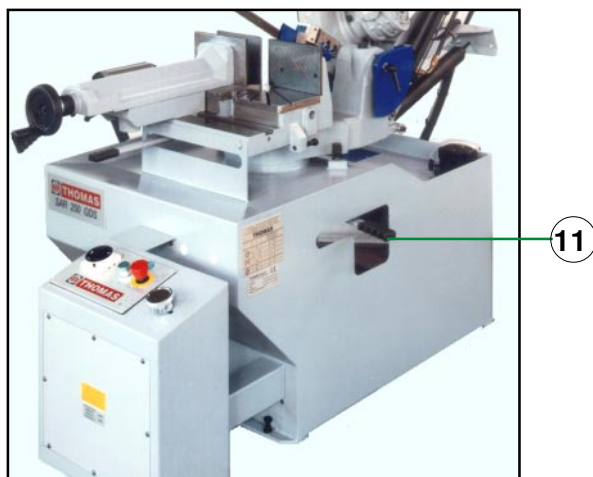



**BEFORE PERFORMING THE FOLLOWING OPERATIONS, THE ELECTRIC POWER SUPPLY AND THE POWER CABLE MUST BE COMPLETELY DISCONNECTED.**

### 7.7 - Changing the blade

To change the blade:

- Lift the saw frame.
- Loosen the blade with the handwheel, remove the mobile blade-guard cover, open the flywheel guards and remove the old blade from the flywheels and the blade guide blocks.
- Assemble the new blade by placing it first between the pads and then on the race of the flywheels, paying particular attention to the cutting direction of the teeth.
- Tension the blade and make sure it perfectly fits inside the seat of the flywheels.
- Assemble the mobile blade-guide and the flywheel guard and fasten it with the relative knobs. Check that the safety microswitch is activated otherwise when electric connection will be restored the machine will not start.

**WARNING:** always assemble blades having dimensions specified in this manual and for which the blade guide heads have been set: otherwise, see chapter on "Description of the operating cycle" in the section Starting-up.

### 7.8 - Replacing saw frame return spring

- When performing this operation it is necessary to keep saw frame up using the lifting device.
- Replace the spring by loosening the upper coupling rod and releasing it from the lower tie-rod.

**RELY ON SKILLED AND QUALIFIED PERSONNEL TO REPLACE OTHER MACHINE MEMBERS SUCH AS REDUCTION UNIT OR VARIATOR, PUMP MOTOR AND ELECTRICAL COMPONENTS.**

## 8 ROUTINE AND SPECIAL MAINTENANCE

THE MAINTENANCE JOBS ARE LISTED BELOW, DIVIDED INTO DAILY, WEEKLY, MONTHLY AND SIX-MONTHLY INTERVALS. IF THE FOLLOWING OPERATIONS ARE NEGLECTED, THE RESULT WILL BE PREMATURE WEAR OF THE MACHINE AND POOR PERFORMANCE.

### 8.1 - Daily maintenance

- General cleaning of the machine to remove accumulated shavings.
- Clean the lubricating coolant drain hole to avoid excess fluid.
- Top up the level of lubricating coolant.
- Check blade for wear.
- Rise of saw frame to top position and partial slackening of the blade to avoid useless yield stress.
- Check functionality of the shields and emergency stops.

### 8.2 - Weekly maintenance

- More accurate general cleaning of the machine to remove shavings, especially from the lubricant fluid tank.
- Removal of pump from its housing, cleaning of the suction filter and suction zone.
- Clean the filter of the pump suction head and the suction area.
- Cleaning with compressed air the blade guide heads (guide bearings and drain hole of the lubricating cooling).
- Cleaning flywheel housings and blade sliding surfaces on flywheels.

### 8.3 - Monthly maintenance

- Check the tightening of the motor flywheel screws.
- Check that the blade guide bearings on the heads are perfect running condition.
- Check the tightening of the screws of the gearmotor, pump and accident protection guarding.

### 8.4 - Six-monthly maintenance

- Continuity test of the equipotential protection circuit.

### 8.5 - Maintenance of the operating machine members

The worm drive gear box mounted on the machine is maintenance-free guaranteed by its manufacture.

### 8.6 - Oils for lubricating coolant

Considering the vast range of products on the market, the user can choose the one most suited to his own requirements, using as reference the type SHELL LUTEM OIL ECO. THE MINIMUM PERCENTAGE OF OIL DILUTED IN WATER IS 8 - 10 %.

### 8.7 - Oil disposal

The disposal of these products is controlled by strict regulations. Please see the Chapter on "Machine dimensions - Transport - Installation" in the section on *Dismantling*.

### 8.8 - Special maintenance

Special maintenance operations must be carried out by skilled personnel. However, we advise contacting THOMAS or their dealer and/or importer. Also the reset of protective and safety equipment and devices, of the reducer, the motor, the motor pump and electric components is to be considered extraordinary maintenance.

# 9 MATERIAL CLASSIFICATION AND CHOICE OF TOOL

Since the aim is to obtain excellent cutting quality, the various parameters such as **hardness of the material, shape and thickness, transverse cutting section** of the part to be cut, **selection of the type of cutting blade, cutting speed** and **control of saw frame lowering**. These specifications must therefore be harmoniously combined in a single operating condition according to practical considerations and common sense, so as to achieve an optimum condition that does not require countless operations to prepare the machine when there are many variations in the job to be performed. The various problems that crop up from time to time will be solved more easily if the operator has a good knowledge of these specifications.

WE THEREFORE RECOMMEND YOU TO ALWAYS USE GENUINE SPARE BLADES THAT GUARANTEE SUPERIOR QUALITY AND PERFORMANCE.

words, the number of teeth per inch (25,4 mm) suitable for thematerial to be cut, according to these criteria:


 
 
- parts with a thin and/or variable section such as profiles, pipes and plate, need close toothing, so that the number of teeth used simultaneously in cutting is from 3 to 6;
- parts with large transverse sections and solid sections need widely spaced toothing to allow for the greater volume of the shavings and better tooth penetration;
- parts made of soft material or plastic (light alloys, mild bronze, teflon, wood, etc.) also require widely spaced toothing;
- pieces cut in bundles require combo tooth design.

## 9.3 - Teeth pitch

As already stated, this depends on the following factors:

- **hardness of the material**
- **dimensions of the section**
- **thickness of the wall.**

BLADE TEETH SELECTION TABLE		
THICKNESS MM	Z CONTINUOUS TOOTH DESIGN	Z COMBO TOOTH DESIGN
TILL 1.5	14	10/14
FROM 1 TO 2	8	8/12
FROM 2 TO 3	6	6/10
FROM 3 TO 5	6	5/8
FROM 4 TO 6	6	4/6
MORE THAN 6	4	4/6

S = THICKNESS

## 9.1 - Definition of materials

The table at the foot of the page lists the characteristics of the materials to be cut, so as to choose the right tool to use.

 
## 9.2 - Selecting blade

First of all the pitch of the teeth must be chosen, in the other


TYPES OF STEEL						CHARACTERISTICS		
USE	I UNI	D DIN	F AF NOR	GB SB	USA AISI-SAE	Hardness BRINELL HB	Hardness ROCKWELL HRB	R=N/mm <sup>2</sup>
Construction steels	Fe360 Fe430 Fe510	St37 St44 St52	E24 E28 E36	---- 43 50	---- ---- ----	116 148 180	67 80 88	360÷480 430÷560 510÷660
Carbon steels	C20 C40 C50 C60	CK20 CK40 CK50 CK60	XC20 XC42H1 ---- XC55	060 A 20 060 A 40 ---- 060 A 62	1020 1040 1050 1060	198 198 202 202	93 93 94 94	540÷690 700÷840 760÷900 830÷980
Spring steels	50CrV4 60SiCr8	50CrV4 60SiCr7	50CV4 ----	735 A 50 ----	6150 9262	207 224	95 98	1140÷1330 1220÷1400
Alloyed steels for hardening and tempering and for nitriding	35CrMo4 39NiCrMo4 41CrAlMo7	34CrMo4 36CrNiMo4 41CrAlMo7	35CD4 39NCD4 40CADG12	708 A 37 ---- 905 M 39	4135 9840 ----	220 228 232	98 99 100	780÷930 880÷1080 930÷1130
Alloyed casehardening steels	18NiCrMo7 20NiCrMo2	---- 21NiCrMo2	20NCD7 20NCD2	En 325 805 H 20	4320 4315	232 224	100 98	760÷1030 690÷980
Alloyed for bearings	100Cr6	100Cr6	100C6	534 A 99	52100	207	95	690÷980
Tool steel	52NiCrMoKU C100KU X210Cr13KU 58SiMo8KU	56NiCrMoV7C100K C100W1 X210Cr12 ----	---- ---- Z200C12 Y60SC7	---- ---- BS 1 BD2-BD3 ----	---- ---- S-1 D6-D3 S5	244 212 252 244	102 96 103 102	800÷1030 710÷980 820÷1060 800÷1030
Stainless steels	X12Cr13 X5CrNi1810 X8CrNi1910 X8CrNiMo1713	4001 4301 ---- 4401	---- Z5CN18.09 ---- Z6CDN17.12	---- 304 C 12 ---- 316 S 16	410 304 ---- 316	202 202 202 202	94 94 94 94	670÷885 590÷685 540÷685 490÷685
Copper alloys Special brass Bronze	Aluminium copper alloy G-CuAl11Fe4Ni4 UNI 5275 Special manganese/silicon brass G-CuZn36Si1Pb1 UNI5038 Manganese bronze SAE43 - SAE430 Phosphor bronze G-CuSn12 UNI 7013/2a					220 140 120 100	98 77 69 56,5	620÷685 375÷440 320÷410 265÷314
Cast iron	Gray pig iron G25 Spheroidal graphite cast iron GS600 Malleable cast iron W40-05					212 232 222	96 100 98	245 600 420



SOLID Ø OR L MM	Z CONTINUOUS TOOTH DESIGN	Z COMBO TOOTH DESIGN
TILL 30	8	5/8
FROM 30 TO 60	6	4/6
FROM 40 TO 80	4	4/6
MORE THAN 90	3	3/4



Ø = DIAMETER      L = WIDTH




### 9.4 - Cutting and advance speed

 The cutting speed (m/min) and the advance speed (cm<sup>2</sup>/min = area travelled by the disk teeth when removing shavings) are limited by the development of heat close to the tips of the teeth.


- The cutting speed is subordinate to the resistance of the material ( $R = N/mm^2$ ), to its hardness (HRC) and to the dimensions of the widest section.
- Too high an advance speed (= lowering of the saw frame) tends to cause the disk to deviate from the ideal cutting path, producing non rectilinear cuts on both the vertical and the horizontal plane.

The best combination of these two parameters can be seen directly examining the chips.

Long spiral-shaped chips indicate ideal cutting.



 Very fine or pulverized chips indicate lack of feed and/or cutting pressure.



Thick and/or blue chips indicate overload of the blade.



### 9.5 - Blade running-in

When cutting for the first time, it is good practice to run in the tool making a series of cuts at a low advance speed (= 30-35 cm<sup>2</sup>/min on material of average dimensions with respect to the cutting capacity and solid section of normal steel with  $R = 410-510 N/mm^2$ ), **generously spraying the cutting area with lubricating coolant**.

### 9.6 - Blade structure

Bi-metal blades are the most commonly used. They consist in a silicon-steel blade backing with electron beam or laser welded high speed steel (HHS) cutting edge. The type of stocks are classified in M2, M42, M51 and differ from each other because of their major hardness due to the increasing percentage of Cobalt (Co) and molybdenum (Mo) contained in the metal alloy.

### 9.7 - Blade type

They differ essentially in their constructive characteristics, such as:

- **shape** and cutting **angle** of tooth
- **pitch**
- **set**


#### Shape and angle of tooth

**REGULAR TOOTH:** 0° rake and constant pitch.




Most common form for transversal or inclined cutting of solid small and average cross-sections or pipes, in laminated mild steel and grey iron or general metal.

**POSITIVE RAKE TOOTH:** 9° - 10° positive rake and constant pitch.

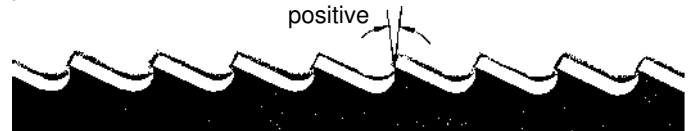


Particular use for crosswise or inclined cuts in solid sections or large pipes, but above all harder materials (highly alloyed and stainless steels, special bronze and forge pig).

**COMBO TOOTH:** pitch varies between teeth and consequently varying teeth size and varying gullet depths. Pitch varies between teeth which ensures a smoother, quieter cut and longer blade life owing to the lack of vibration.

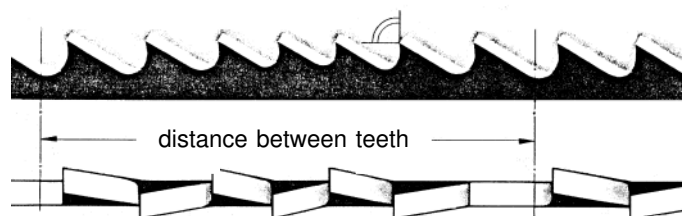

Another advantage offered in the use of this type of blade in the fact that with an only blade it is possible to cut a wide range of different materials in size and type.


**COMBO TOOTH:** 9° - 10° positive rake.

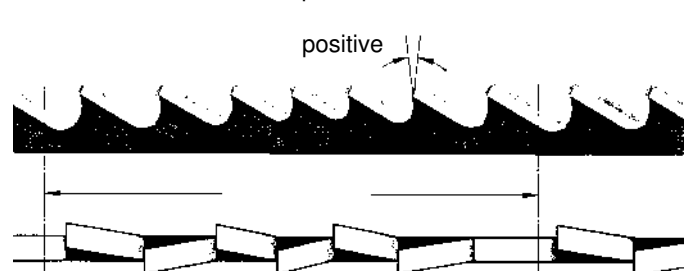


This type of blade is the most suitable for the cutting of section bars and large and thick pipes as well as for the cutting of solid bars at maximum machine capacity. Available pitches: 3-4/4-6.

### Set

 Saw teeth bent out of the plane of the saw body, resulting in a wide cut in the workpiece.



 **REGULAR OR RAKER SET:** Cutting teeth right and left, alternated by a straight tooth.



Of general use for materials with dimensions superior to 5 mm. Used for the cutting of steel, castings and hard nonferrous materials.

**WAVY SET:** Set in smooth waves.



This set is associated with very fine teeth and it is mainly used for the cutting of pipes and thin section bars (from 1 to 3 mm).

**ALTERNATE SET (IN GROUPS):** Groups of cutting teeth right and left, alternated by a straight tooth.



This set is associated with very fine teeth and it is used for extremely thin materials (less than 1 mm).

**ALTERNATE SET (INDIVIDUAL TEETH):** Cutting teeth right and left.



This set is used for the cutting of nonferrous soft materials, plastics and wood.

### 9.7.1 - RECOMMENDED CUTTING PARAMETERS

STEEL	CUTTING SPEED	LUBRICATION
CONSTRUCTION	60/80	EMULSIFIABLE OIL
CEMENTATION	40/50	EMULSIFIABLE OIL
CARBON STEEL	40/60	EMULSIFIABLE OIL
HARDENING AND TEMPERING	40/50	EMULSIFIABLE OIL
BEARINGS	40/60	EMULSIFIABLE OIL
SPRINGS	40/60	EMULSIFIABLE OIL
FOR TOOLS	30/40	EMULSIFIABLE OIL
FOR VALVES	35/50	EMULSIFIABLE OIL
STAINLESS STEEL	30/40	EMULSIFIABLE OIL
SPHEROIDAL GRAPHITE	20/40	EMULSIFIABLE OIL
CAST IRON	40/60	EMULSIFIABLE OIL
ALUMINIUM	80/600	KEROSENE
BRONZE	70/120	EMULSIFIABLE OIL
HARD BRONZE	30/60	EMULSIFIABLE OIL
BRASS	70/350	EMULSIFIABLE OIL
COPPER	50/720	EMULSIFIABLE OIL



# 10 MACHINE COMPONENTS

## 10.1 - List of spare parts


REFERENCE N°	DESCRIPTION
1 .....	Base
2 .....	Arm locking lever
3 .....	Bush
4 .....	Rear metal protection ( Only SAR 250 SA GDS )
5 .....	Roller support
6 .....	Roller
7 .....	Crucible
8 .....	Electropump
9 .....	Arm pivot
10 .....	Counterservice plate
11 .....	Arm
12 .....	Hinge pivot
13 .....	Bearing 32007 X
14 .....	Ring Nilos 32007 XAV
15 .....	Eccentric bush
16 .....	Bearing 32007 XAV
17 .....	Ring Nilos 32007 XAV
18 .....	Ring nut Guk M 35
19 .....	Counterservice
20 .....	Left counterservice plate
21 .....	Right counterservice plate
22 .....	Left counterservice jaw
23 .....	Right counterservice jaw
24 .....	Vice jaw
25 .....	Vice
26 .....	
27 .....	
28 .....	
29 .....	Nut
30 .....	Spring
31 .....	Vice gib
32 .....	Vice support
33 .....	Pin
34 .....	Bush
35 .....	Vice lever
36 .....	Handle
37 .....	Pin
38 .....	Bar stop rod
39 .....	Bar stop pointer
40 .....	Bar stop body
41 .....	
42 .....	Cylinder plate
43 .....	Ring
44 .....	Cylinder fork
45 .....	Pin
46 .....	
48 .....	
49 .....	Splash protection
50 .....	Handle


REFERENCE N°	DESCRIPTION
51 .....	Plate
52 .....	Washer
53 .....	Plate
54 .....	Microswitch plate
55 .....	Microswitch
56 .....	
58 .....	Vice screw
59 .....	Rapid locking spring
60 .....	Vice lever bushing
61 .....	Rapid locking vice lever
62 .....	Handle
63 .....	Bearing CP 30407 + AX 30407
64 .....	Rapid locking lever washer
65 .....	Vice handwheel
66 .....	Brake cylinder
67 .....	Cylinder articulation
68 .....	Cylinder support
70 .....	Rear part of the sawframe
71 .....	Front part of the sawframe
72 .....	Blade tension plate
73 .....	Pivot
74 .....	Blade tension Microswitch
75 .....	Microswitch supporting plate
76 .....	Blade tension guide
77 .....	Blade tension pin
78 .....	Springs
79 .....	Blade tension handwheel
80 .....	Lever
81 .....	Handle
82 .....	Ring Nilos 32006 XAV
83 .....	Spacer ring
84 .....	Bearing 32006 X
85 .....	Return flywheel
86 .....	Ring nut Guk M 35
87 .....	Screw TE M 12
88 .....	Washer
89 .....	Motor flywheel
90 .....	Bearing 6208 2RS
91 .....	Wrench
92 .....	Wrench
93 .....	Motor flywheel shaft
94 .....	Reduction unit
95 .....	Electric motor
96 .....	
98 .....	






PART NUMBER	DESCRIPTION
99 .....	Plate
100 .....	Coolant distributor
101 .....	Connection
102 .....	Coolant tap
103 .....	Connection
104 .....	Microswitch
105 .....	Knob
106 .....	Cover
107 .....	Handle
108 .....	Plate
109 .....	Connection
110 .....	Blade-guide rod
111 .....	Short eccentric pin
112 .....	Long eccentric pin
113 .....	Bearing 608 2RS
114 .....	Blade-guide protection
115 .....	Fixed blade-guide pad
116 .....	Mobile blade-guide pad
117 .....	Mobile blade-guide block
118 .....	Blade protection
119 .....	Fixed blade-guide block
120 .....	Blade-guide rod
121 .....	Blade cleaning brush
122 .....	Brush support
123 .....	Bearing 626 2RS
124 .....	Bush
127 .....	Cylinder support
130 .....	Electric box
131 .....	Electric box cover

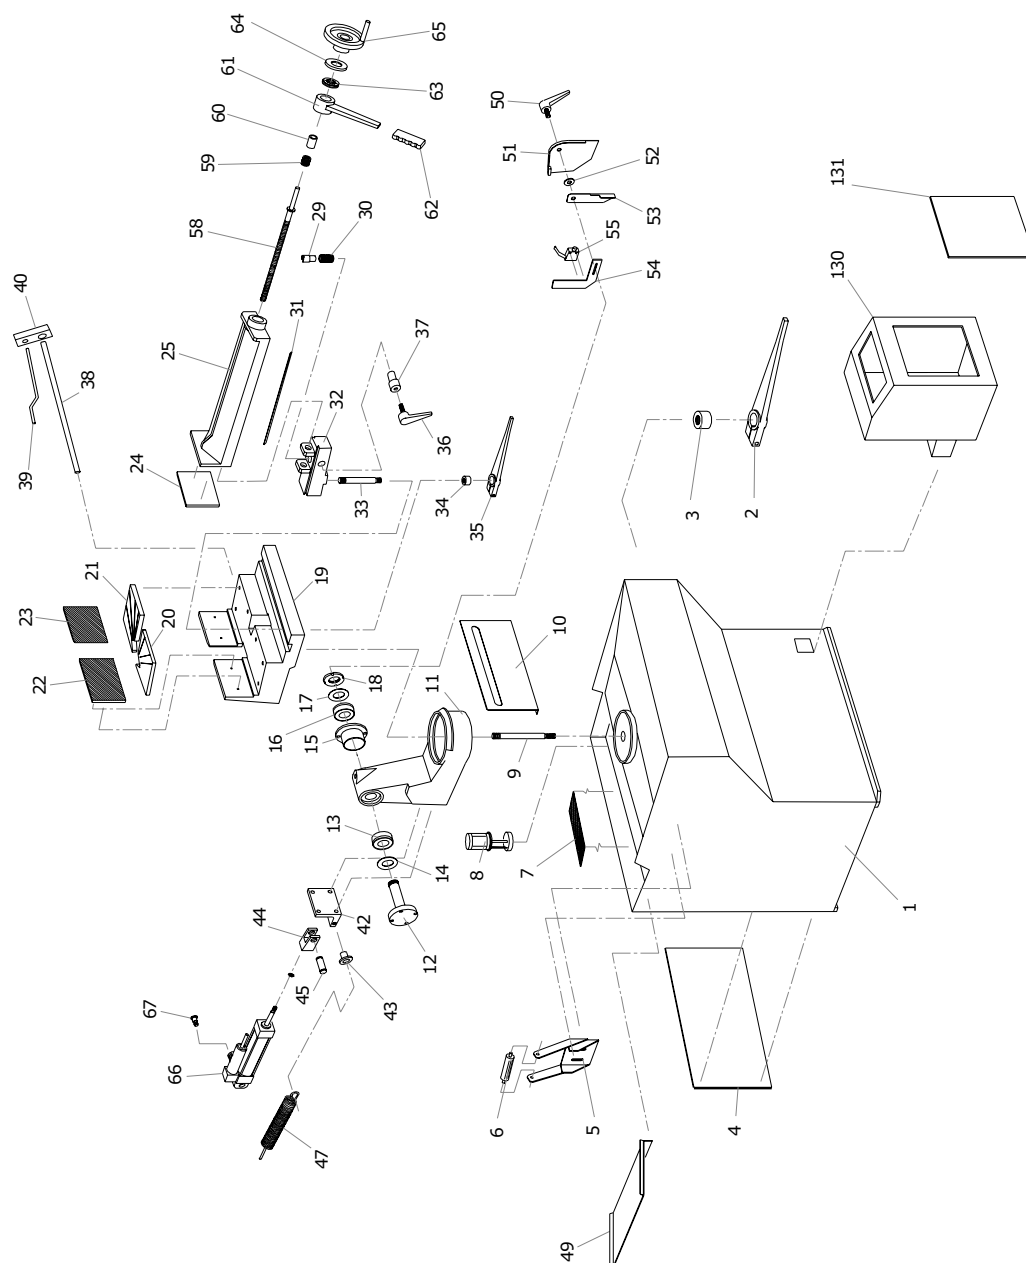

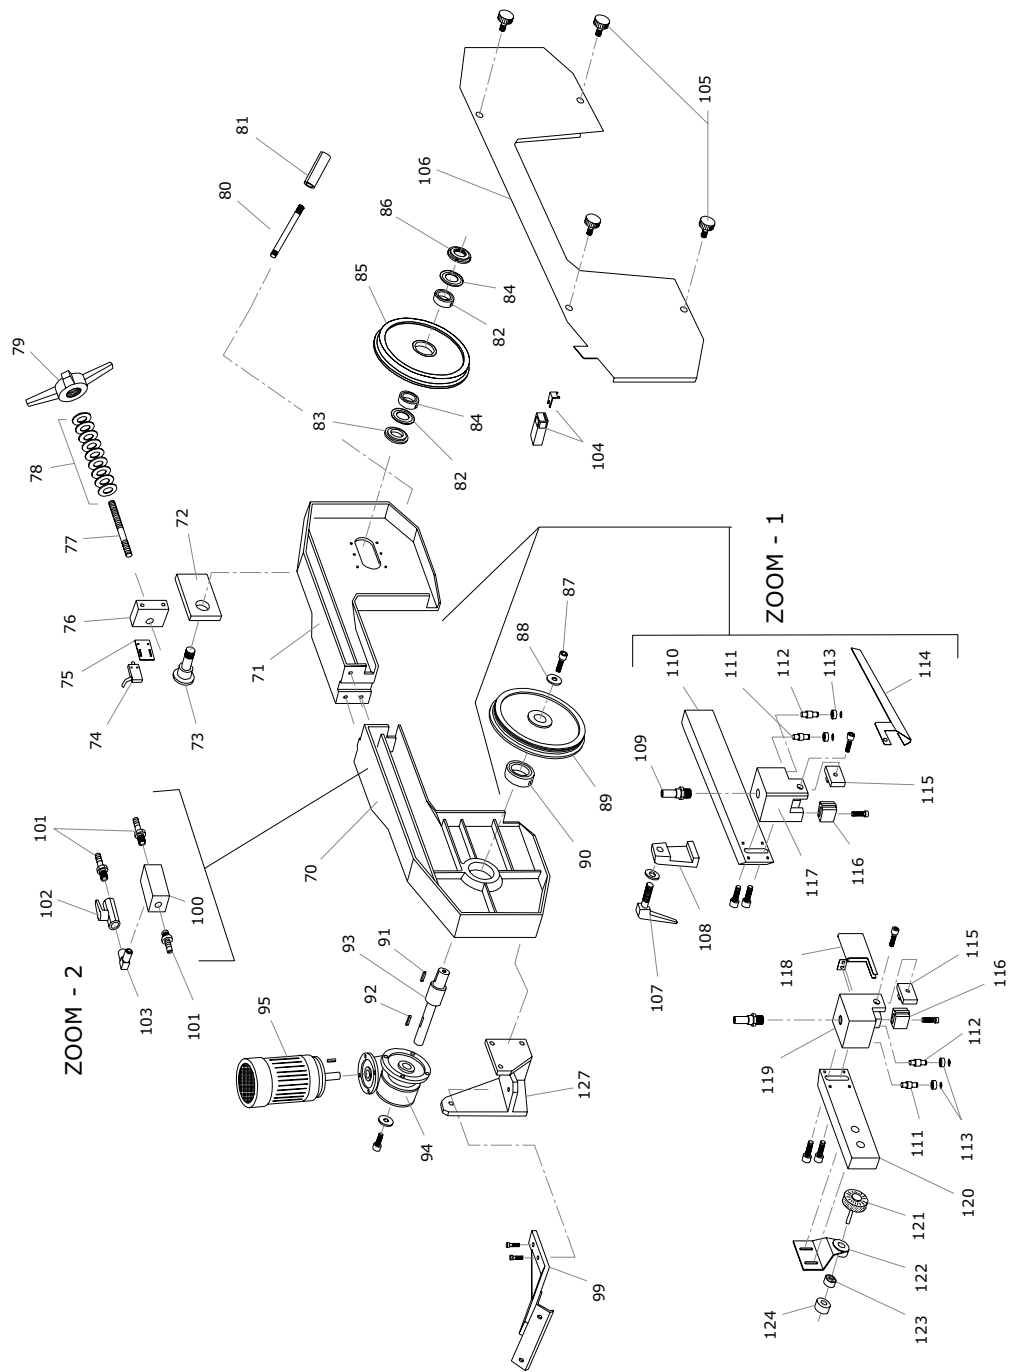


### LEGENDA:

- 401 Speed switch
- 402 Cycle start push-button
- 403 Light
- 404
- 405
- 406 Emergency push-button
- 407 Sawframe downfeed regulator

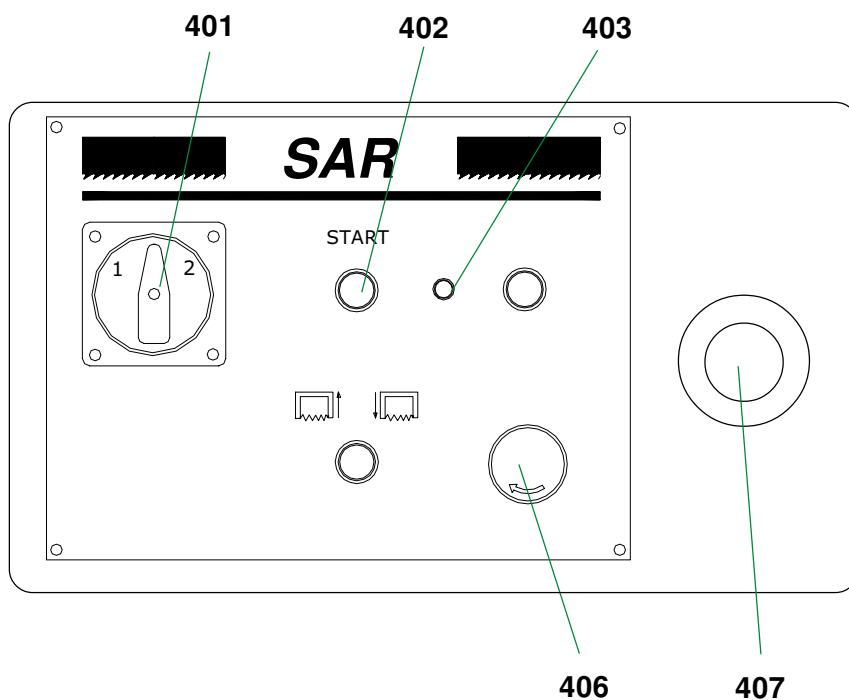


### LEGENDA:

- 410 transformer ( TC )
- 411 Remote switch ( KM )
- 412 Fuse cartridge ( FU 3 )
- 413 Fuse cartridge ( FU 1 )
- 414 Fuse cartridge ( FU 2 )

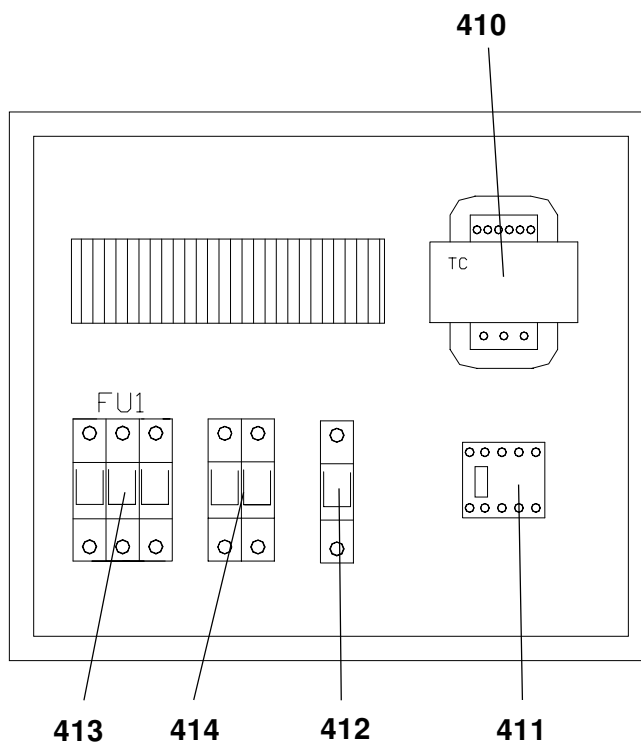

### 11 WIRING DIAGRAMS

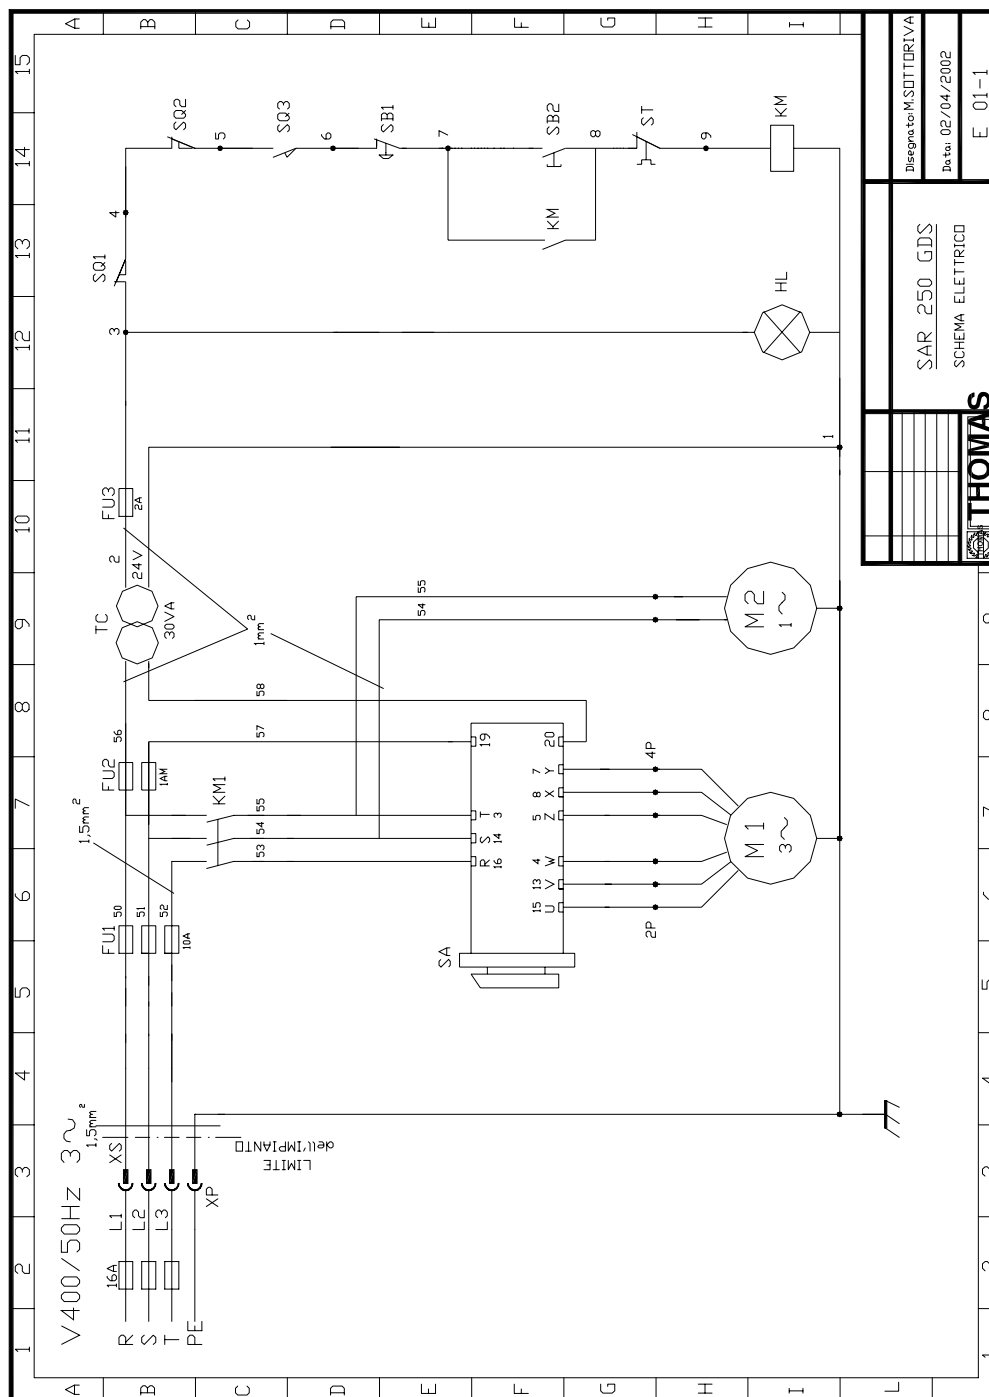

CODE	DESCRIPTION
M1	Band motor
M2	Pump
SA	Speed switch
FU1	Fuse cartridge
FU2	Fuse cartridge
FU3	Fuse cartridge
TC1	Transformer
SQ1	Microswitch
SQ2	Microswitch

CODE	DESCRIPTION
SB1	Mushroom button
SB2	Luminous button
HL	Pilot lamp
KM	Remote-control switch
ST1	Band motor temperature probe



Disegnato M. SUTTORIVA
Data: 02/04/2002
SAR 250 GDS
SCHEMA ELETTRICO
E 01-1




# 12 TROUBLESHOOTING

This chapter lists the probable faults and malfunctions that could occur while the machine is being used and suggests possible remedies for solving them.


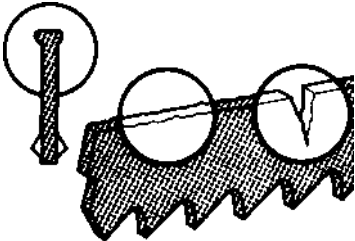
The first paragraph provides diagnosis for TOOLS and CUTS, the second for ELECTRICAL COMPONENTS.

## 12.1 - Blade and cut diagnosis

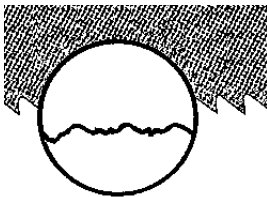FAULT	PROBABLE CAUSE	REMEDY
<b>TOOTH BREAKAGE</b>  	<p>Too fast advance</p> <p>Wrong cutting speed</p> <p>Wrong tooth pitch</p> <p>Chips sticking onto teeth and in the gullets or material that gums</p> <p>Defects on the material or material too hard</p> <p>Ineffective gripping of the part in the vice</p> <p>The blade gets stuck in the material</p> <p>Starting cut on sharp or irregular section bars</p> <p>Poor quality blade</p> <p>Previously broken tooth left in the cut</p> <p>Cutting resumed on a groove made previously</p> <p>Vibrations</p> <p>Wrong tooth pitch or shape</p> <p>Insufficient lubricating refrigerant or wrong emulsion</p> <p>Teeth positioned in the direction opposite the cutting direction</p>	<p>Decrease advance, exerting less cutting pressure. Adjust the braking device.</p> <p>Change speed and/or type of blade. See chapter on <b>"Material classification and blade selection"</b>, in the section <i>Blade selection table according to cutting and feed speed</i>.</p> <p>Choose a suitable blade. See Chapter <b>"Material classification and blade selection"</b>.</p> <p>Check for clogging of cooling liquid drain holes on the blade-guide blocks and that flow is plentiful in order to facilitate the removal of chips from the blade.</p> <p>Material surfaces can be oxidised or covered with impurities making them, at the beginning of the cut, harder than the blade itself, or have hardened areas or inclusions inside the section due to productive agents used such as casting sand, welding wastes, etc. Avoid cutting these materials or in any case perform cutting with extreme care, cleaning and removing such impurities as quickly as possible.</p> <p>Check the gripping of the part.</p> <p>Reduce feed and exert less cutting pressure.</p> <p>Pay more attention when you start cutting.</p> <p>Use a superior quality blade.</p> <p>Accurately remove all the parts left in.</p> <p>Make the cut elsewhere, turning the part.</p> <p>Check gripping of the part.</p> <p>Replace blade with a more suitable one. See <b>"Material classification and blade selection"</b> in the <i>Blade Types</i> section. Adjust blade guide pads.</p> <p>Check level of liquid in the tank. Increase the flow of lubricating refrigerant, checking that the hole and the liquid outlet pipe are not blocked.</p> <p>Check the emulsion percentage.</p> <p>Turn teeth in correct direction.</p>

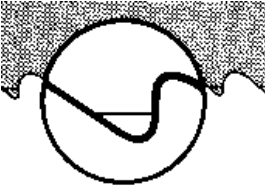
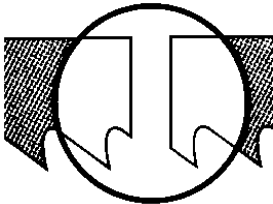
FAULT	PROBABLE CAUSE	REMEDY
<p><b>PREMATURE BLADE WEAR</b></p> 	<p>Faulty running-in of blade</p> <p>Teeth positioned in the direction opposite the cutting direction</p> <p>Poor quality blade</p> <p>Too fast advance</p> <p>Wrong cutting speed</p> <p>Defects on the material or material too hard</p> <p>Insufficient lubricating refrigerant or wrong emulsion</p>	<p>See <b>“Material classification and blade selection”</b> in the <i>Blade running-in</i> section.</p> <p>Turn teeth in correct direction.</p> <p>Use a superior quality blade.</p> <p>Decrease advance, exerting less cutting pressure. Adjust the braking device.</p> <p>Change speed and/or type of blade.</p> <p>See chapter on <b>“Material classification and blade selection”</b>, in the section <i>Blade selection table according to cutting and feed speed</i>.</p> <p>Material surfaces can be oxidised or covered with impurities making them, at the beginning of the cut, harder than the blade itself, or have hardened areas or inclusions inside the section due to productive agents used such as casting sand, welding wastes, etc. Avoid cutting these materials or in any case perform cutting with extreme care, cleaning and removing such impurities as quickly as possible.</p> <p>Check level of liquid in the tank. Increase the flow of lubricating refrigerant, checking that the hole and the liquid outlet pipe are not blocked.</p> <p>Check the emulsion percentage.</p>
<p><b>BLADE BREAKAGE</b></p>  	<p>Faulty welding of blade</p> <p>Too fast advance</p> <p>Wrong cutting speed</p> <p>Wrong tooth pitch</p> <p>Ineffective gripping of the part in the vice</p> <p>Blade touching material at beginning of cut</p>	<p>The welding of the blade is of utmost importance. The meeting surfaces must perfectly match and once they are welded they must have no inclusions or bubbles; the welded part must be perfectly smooth and even. They must be evenly thick and have no bulges that can cause dents or instant breakage when sliding between the blade guide pads.</p> <p>Decrease advance, exerting less cutting pressure. Adjust the braking device.</p> <p>Change speed and/or type of blade.</p> <p>See chapter on <b>“Material classification and blade selection”</b>, in the section <i>Blade selection table according to cutting and feed speed</i>.</p> <p>Choose a suitable blade. See Chapter <b>“Material classification and blade selection”</b>.</p> <p>Check the gripping of the part.</p> <p>At the beginning of the cutting process, never lower the saw frame before starting the blade motor.</p>



FAULT	PROBABLE CAUSE	REMEDY
 	Blade guide pads not regulated or dirty because of lack of maintenance	Check distance between pads (see “ <b>Machine adjustments</b> ” in the <i>Blade Guide Blocks</i> section): extremely accurate guiding may cause cracks and breakage of the tooth. Clean carefully.
	Blade guide block too far from material to be cut	Approach head as near as possible to material to be cut so that only the blade section employed in the cut is free, this will prevent deflections that would excessively stress the blade.
	Improper position of blade on fly-wheels	The back of blade rubs against the support due to deformed or poorly welded bands (tapered), causing cracks and swelling of the back contour.
	Insufficient lubricating refrigerant or wrong emulsion	Check level of liquid in the tank. Increase the flow of lubricating refrigerant, checking that the hole and the liquid outlet pipe are not blocked. Check the emulsion percentage.
<b>STREAKED OR ETCHED BANDS</b>	Damaged or chipped blade guide pads	Replace them.
	Tight or slackened blade guide bearings	Adjust them (see Chapter “ <b>Machine adjustments</b> ” in <i>Blade guide</i> section).
<b>CUTS OFF THE STRAIGHT</b>	Blade not parallel as to the counter-vice	Check fastenings of the blade guide blocks as to the counter-vice so that they are not too loose and adjust blocks vertically; bring into line the position of the degrees and if necessary adjust the stop screws of the degree cuts.
	Blade not perpendicular due to the excessive play between the guide pads and maladjustment of the blocks	Check and vertically re-adjust the blade guide blocks; reset proper side guide play (see Chapter “ <b>Machine adjustments</b> ” in <i>Blade guide</i> section).
	Too fast advance	Decrease advance, exerting less cutting pressure. Adjust the braking device.
	Blade guide block too far from material to be cut	Approach it as near as possible to material to be cut so that only the blade section employed in the cut is free, this will prevent deflections that would excessively stress the blade.
	Worn out blade	Replace it.
	Wrong tooth pitch	Blade with major density of teeth is being used, try using one with less teeth (see Chapter “ <b>Material classification and blade selection</b> ” in the <i>Blade Types</i> section).



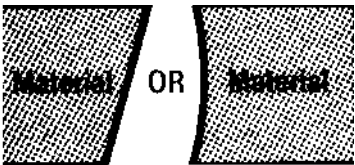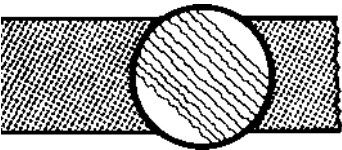

FAULT	PROBABLE CAUSE	REMEDY
	Broken teeth	Irregular work of the blade due to the lack of teeth can cause deflection in the cut; check blade and if necessary replace it.
	Insufficient lubricating refrigerant or wrong emulsion	Check level of liquid in the tank. Increase the flow of lubricating refrigerant, checking that the hole and the liquid outlet pipe are not blocked. Check the emulsion percentage.
FAULTY CUT	Worn out flywheels	The support and guide flange of the band are so worn out that they cannot ensure the alignment of the blade, causing faulty cutting; blade rolling and drawing tracks can have become tapered. Replace them.
	Flywheel housing full of chips	Clean with compressed air.
STREAKED CUTTING SURFACE	Too fast advance	Decrease advance, exerting less cutting pressure. Adjust the braking device.
	Poor quality blade	Use a superior quality blade.
	Worn out blade or with chipped and/or broken teeth	Replace it.
	Wrong tooth pitch	Blade used probably has too large teeth; use one with more teeth (see “ <b>Material classification and blade selection</b> ” in the <i>Blade Types</i> section).
	Blade guide block too far from material to be cut	Approach it as near as possible to material to be cut so that only the blade section employed in the cut is free, this will prevent deflections that would excessively stress the blade.
	Insufficient lubricating refrigerant or wrong emulsion	Check level of liquid in the tank. Increase the flow of lubricating refrigerant, checking that the hole and the liquid outlet pipe are not blocked. Check the emulsion percentage.
NOISE ON GUIDE BLOCKS	Chipped bearings	Dirt and/or chips between blade and guide bearings. Replace them.
	Worn out or damaged pads	Replace them.



### 12.2 - Electrical components diagnosis

FAULT	PROBABLE CAUSE	REMEDY
<b>MACHINE DOES NOT WORK</b>	Power supply	Check: <ul style="list-style-type: none"> <li>- phases</li> <li>- cables</li> <li>- socket</li> <li>- plug</li> </ul> Voltage must arrive upstream from the fuses (terminal board).
	Fuses "FU 1"	Check electrical efficiency and check for shorts that trigger such protections. Check closing of the flywheel guard. Check the efficiency of the device; replace it if damaged.
	"SQ 1" safety microswitch	
	Speed switch "SA" in position "0" Emergency button "SB 1" on	
	Cycle START button "SB 2"	It must be turned to position 1 or 2. Ensure that it is off and that its contacts are unbroken. Check mechanical efficiency; replace if damaged.
	Thermal probe built into the stator winding has tripped due to motor over-heating	Check current continuity on the two wires in the prone after letting the motor cool for about 10-15 minutes. If after this time there is no current continuity in the two wires, the motor must be changed or re-wound.
	Transformer "TC 1"	Check that the supply voltage is the same as the line voltage and that it gives a value of 24 V at output.
	Fuse "FU 2 - FU 3"	Check fuse efficiency and ensure there are no short circuits causing the protection to trip.
<b>MOTOR STOPPED WITH PILOT LIGHT "HL" LIT</b>	Microswitch "SQ1 "	Check operation and/or efficiency; replace if broken
	Remote-control switch "KM"	Check that phases are present at both input and output; ensure that it is not blocked, that it closes when fed, that it does not cause short circuits; otherwise change it.
	Motor "M 1"	Check that it is not burnt and that it turns freely. It may be rewound or changed.

## 13 NOISE TESTS

In accordance with point 1.7.4.f of the Machines Directive EEC 89/392

- The microphone was positioned close to the operator's head, at medium height.
  - The saw during normal working condition, delivers the following acoustic pressure:
    - . On idle running : 65,7 dB (A).
    - . During cutting cycle sawing a UNI C40 steel bar diam. 50 : 64,4 dB (A).
  - The maximum level of the WEIGHTED instantaneous acoustic pressure C was always less than 130 dB.
- NOTE: with the machine operating, the noise level will vary according to the different materials being processed. The user must therefore assess the intensity and if necessary provide the operators with the necessary personal protection, as required by Law 277/1991.



### PLATES AND LABELS

